

→ Gloss Black ←

Ship. July 28

Work Order ID 163754

Thursday, July 06, 2017 1:39:52 PM

S/O 130827

163754

Page 1

Item ID: D4680-041

Revision ID: URF 17-547

Item Name: Skidtube Assembly

Start Date: 7/17/2017 Start Qty: 1.00

Required Date: 7/27/2017 Req'd Qty: 1.00

Reference:

Approvals:

Process Plan:

Date: JUL 06 2017

QC:

Date: SPC (Y/N):

N9000040100

Setup Start *NS1*

Stop *NS2*

Cust Item ID:

Customer:

PRELIMINARY ISSUE

Run Start *NR1*

Stop *NR2*

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

Draw Nbr

Revision Nbr

D4680 PRELIM.

F

120

120

Skidtubes

Skidtubes

Skidtubes

Memo

PICK D4680-041 BENT

1-Cut Aft end as per dwg D4680

2-Deburr ends

3-Drill Aft & Fwd Cap holes using DT8678 & DT8901 open aft cap 0.187".

4-Locate DT10149 & Drill Ground wire hole on top of Tube.

5-Locate DT10149 with 0.187" cleco in aft cap, then Pilot Drill all X-Bolt holes using 0.187" drill.

6--Drill holes for D5520-1 doubler using DT10309 A & B, Detail H. Locating from 3th and 4th crossbolt holes from aft using .1875 clekos. Spot drill tube using #20 drill (note 10). Remove DT10309 B. Re-install DT 10309 A drill thru tube and doubler using #20 drill (note 10), cleko as you go. Remove .1875 clekos and open holes in tube and doubler to 0.750". Remove doublers and identify orientation. *Countersink detail H as per dwg note 13*

7-Open remaining X-Bolt holes to .750" (8 places)

8-Open ground wire hole .297" at 95.75" (1 at fwd end & 2 at aft end at 20.81" ref.)

1 17-07-27 BE

D4680 9-89 17-7-12

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No: _____ NCR No: _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 163754***163754***

Page 2

Thursday, July 06, 2017 1:39:52 PM

Item ID: D4680-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 17-547 Stop ***NS2***
Item Name: Skidtube Assembly
Start Date: 7/17/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 7/27/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

9- 3 most fwd x-bolt holes must be laid out manually, open to #30.

10-Open Aft & Fwd Cap holes using .208" drill.

11- Drill Rivet Holes as per Dwg D4680 using DT10065 Detail D. 8 places per side.

12-Deburr holes.

140

140

QC

Quality Control

QC5- Inspect part completeness to step on W/O 0.00

Memo

0.02

150

150

HandFinish

Hand Finishing

Chemical Conversion Coat per QSI005 4.1 0.00

Memo

0.78

BE 1707-27

DAS
38
9-89

JUL 27 2017

BE 1707-31

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Thursday, July 06, 2017 1:39:52 PM

Page 3

Stop *NS2*

Customer:

Run Start *NR1*

Stop *NR2*

NR2

[illegible]

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Work Order ID 163754

Thursday, July 06, 2017 1:39:52 PM

163754

Page 4

Item ID: D4680-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 17-547 Stop ***NS2***
Item Name: Skidtube Assembly
Start Date: 7/17/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 7/27/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

170

170

Skidtubes

Skidtubes

Skidtubes

Memo

0.80

1-Install doublers using DT10309 B. Detail H. Shave rivets as required.

2- Bond web as per Dwg D4680 & QSI015

A/R 241 Sike Flex

Batch: M137946Exp Date: 29 MAR 2018

start time: _____

end time: _____

3- Seal all faying surfaces using proseal and rivet Doubler as per Dwg D4680.
Detail D.A/R Proseal Batch: 136953exp date: 10/17

LET IT CURE FOR 7HRS

START TIME: _____

FINISH TIME: _____

4-Shave rivet as required, remove Proseal spill over.

5- Ream holes section C-C as per dwg, deburr 8 places (Through doubler and tube).

6- Swage x-bolt spacers as per Dwg D4680 and sectionl C-C 8 places.

7- Swage x-bolt spacer as per dwg D4680 section G-G & boreout as per dwg

8- Trim/Grind flush per QSI 002

> BE1708-01

BE1708-01

> BE1708-01 02

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
☐ OTHER : _____									

Work Order ID 163754

Thursday, July 06, 2017 1:39:52 PM

163754

Page 5

Item ID: D4680-041 **Accept** ***N900040100*** **Setup Start** ***NS1***
Revision ID: URF 17-547 **Stop** ***NS2***
Item Name: Skidtube Assembly
Start Date: 7/17/2017 **Start Qty:** 1.00 ***1*** **Cust Item ID:**
Required Date: 7/27/2017 **Req'd Qty:** 1.00 ***1*** **Customer:**
Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____ **Run Start** ***NR1***
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____ **Stop** ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180 *180* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.02				1			DAG 38 AUG 03 2017
									POSITIVE RECALL EFFECTIVE 7/17/16 AUTH RELEASED DATE 170803
210 *210* HandFinish Hand Finishing	Pressure Wash per QSI005 4.3 Memo	0.00 0.41							2017-08-03 JSL BET
220 *220* Powdercoat Powder Coating	White Gloss (Ref:4.3.5.1) per QSI005 4.3-Alum Memo	0.00 0.27				1			17-08-4 38
	GLOSS BLACK START TIME: 10:05 OVEN TEMPERATURE: 300° FINISH TIME: 10:35								

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																											
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																							
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :	
Misidentified ☐	Past Due ☐																																																														

Work Order ID 163754

Thursday, July 06, 2017 1:39:52 PM

163754

Page 6

Item ID: D4680-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 17-547 Stop ***NS2***
Item Name: Skidtube Assembly
Start Date: 7/17/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 7/27/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230	QC3- Inspect Part Finish	0.00							
230									
QC	Memo	0.01							
Quality Control									
260	HandFinishing	0.00							
260									
HandFinish	Memo	1.01							
Hand Finishing	1- Install Ground Wire inserts as per Dwg D4680.								
	2- Inspect for Foreign objects								
	3- Install Fwd & Aft caps as per Dwg D4680 and Detail "A" & "B". Fastener must be install wet as per note (9).								
	A/R 241 Sika Flex Batch: <u>M136595</u>								
	Exp Date: <u>12/09</u>								
	4- Wing Walk as per Dwg D4680 and QSI 005 4.4								
	Batch: <u>M137447</u>								

DAS
15
9-89

1x d all 12/08/08

1x d all 12/08/08

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : ☐							
Misidentified ☐	Past Due ☐								

Work Order ID 163754

Thursday, July 06, 2017 1:39:52 PM

163754

Page 7

Item ID: D4680-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 17-547 Stop ***NS2***
Item Name: Skidtube Assembly
Start Date: 7/17/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 7/27/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
270	QC5- Inspect part completeness to step on W/O	0.00							
270									DAS 38 9-89
QC	Memo	0.02							AUG 10 2017
Quality Control									P.T.O.
300	Identify as per dwg & Stock Location: <u>PP163754</u>	0.00							
300	Packaging								DAS 38 9-89
Packaging	Memo	0.01							AUG 10 2017
Packaging									
310	QC21- Final Inspection - Work Order Release	0.00							
310									
QC	Memo	0.10							17/9/15
Quality Control									

POSITIVE RECALL
EFFECTIVE 08-02 AUTH PD
RELEASED PD DATE 08-24

DAS
21
9-89
AUG 24 2017

DQA:

Date: 21 Dec 2017



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date:

OCT 31 2017

Work Order update only ☐

Work Order: 163754	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☒ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS					
Part No. D4680-041		Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒		
NCR No. 17-6661		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐		
		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐		
		Large Fab ☐	Composite ☐	Supplier ☐			

Date: 17-08-23	Step #: 170	QTY Effective: 1	MRB (QSI042) Approval
----------------	-------------	------------------	-----------------------

Description Work Order Deviation Skid was install using doubler DSS20-1 Rev A prelim. During assembly part was conforming to drawing and was not called out for primer. DSS20-1 is only alodine as per ECN7-547 release DSS20-1 should now be prime.	Disposition Acceptable. Similar to Job A1/B skid tube that uses no prime prime w/o issue. Skids are non-float.	Completed By DAS 12 17/8/23 9-89 Lead hand / Supervisor Approval Verification DAS 9 17-08-23 9-89 QC / QA Coordinator Approval DAS 9 17-08-23 9-89
--	---	--

Root Cause				FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐		
Design ☒	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐		
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐		
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐		
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐		
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐		
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	☒ Drawing		
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐		
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐		
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐		
Past Expiry Date ☐	Manufacturing Process ☐						
Misidentified ☐	Past Due ☐	OTHER :					

Picklist Print

Thursday, July 06, 2017 1:40:03 PM

Page 1

Work Order ID: 163754

163754

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 7/17/2017

Required Date: 7/27/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV:A 13.04.16 NEW ISSUE DD VERF:JLM IPP
REV:B 13.08.08 PB2 DD VERF:JLM IPP REV:C
13.09.10 PB3 DD VERF:JLM IPP REV:D 13.11.14
AS PER DWG REV.B DD VERF:JLM IPP REV:C 14.11.24 AS PER
DWG REV.C DD VERF:JLM IPP REV:D 15.06.10 AS PER DWG
REV.D DD VERF:JLM IPP REV:E 16.03.23 AS PER DWG REV.E
DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D5520-1		Manufactured	No			120	Each	0.0000	2	2			
D5520-1									**				
Doubler													
CR3212-5-05		Purchased	No			170	Each	0.0000	68	68			
CR3212-5-05									**				
Rivet													
AN526C1032R10		Purchased	No			260	Each	121.0000	2	2			
AN526C1032R10									**				
Screw													

3163670 x2 BE170726

BE17-08-01
m1380410 x68

12108108

Location	Loc Qty	Loc Code
FP001	21	
m135133	21	
ST327	100	
m137851	100	

x2

D5304-1

Manufactured No

D5304-1

Crossbolt Spacer

Location	Loc Qty	Loc Code
LG001	24	
145050	4	
146516	1	
161952	19	

BE17-08-02

2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QS1042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

Picklist Print

Thursday, July 06, 2017 1:40:03 PM

Work Order ID: 163754

163754

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 7/17/2017

Required Date: 7/27/2017

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

260

Each

4,948.000

5

5

NAS1149C0332R

WASHER

**

all 17/08/08

Location

Loc Qty

Loc Code

FP001

598

m137597

598

GA

508

m133284

22

m136444

486

ST260a

3000

m135408

0

m136741

0

m137851

2000

m137951

1000

ST266

842

m137381

842

X5

D4680-041-BENT

Manufactured

No

120

Each

0.0000

1

1

D4680-041-BENT

Extrusion Bent

D4681-041

Manufactured

No

170

Each

5.0000

1

1

D4681-041

Web Assembly

**

Must pick B163755

**

*BE170725
B163755x1*

Location

Loc Qty

Loc Code

LG002

5

146247

5

1 BE1708-01

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Picklist Print

Thursday, July 06, 2017 1:40:03 PM

Work Order ID: 163754

163754

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 7/17/2017

Required Date: 7/27/2017

Start Qty: 1.00

Required Qty: 1.00

D4686-1

Manufactured No

260

Each

64.0000

8

8

D4686-1

Spacer

**

BEIT 08-07

Location

Loc Qty

Loc Code

LG001

64

145075

44

146515

20

8

D4753-1

Manufactured No

260

Each

30.0000

16

16

D4753-1

Doubler

**

BEIT 08-01

Location

Loc Qty

Loc Code

LG001

30

153498

7

161929

23

7 9

AELS-1032-130

AELS8-1032-130

Purchased

No

260

Each

0.0000

3

3

AFI S-1032-130

Rivnut

**

(x3) 12/08/08

* ALS4-1032-130 / M136579

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Picklist Print

Thursday, July 06, 2017 1:40:03 PM

Work Order ID: 163754

163754

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 7/17/2017

Required Date: 7/27/2017

Start Qty: 1.00

Required Qty: 1.00

AN3C4A

Purchased

No

260

Each

1,100.000

3

3

AN3C4A

Bolt

**

all 12/08/09

Location

Loc Qty

Loc Code

FG

20

122814

20

FP001

245

M136450

23

M136740

8

M136986

20

M137075

43

M137164

2

M137361

5

M137820

144

OVER002

800

M137507

150

M137587

250

M137963

400

ST350

35

M135704

35

MS20601-AD4W3

Purchased

No

260

Each

445.0000

32

32

MS20601-AD4W3

Rivet

**

BE708-01

Location

Loc Qty

Loc Code

CCK004

300

m137820

200

m137963

100

LG001

35

m137459

35

ST308

110

m137587

110

32

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Picklist Print

Thursday, July 06, 2017 1:40:03 PM

Work Order ID: 163754

163754

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 7/17/2017

Required Date: 7/27/2017

Start Qty: 1.00

Required Qty: 1.00

D2965

Manufactured No

260 Each 30.0000 1 1

D2965

Cap

**

all 12/08/09

Location

Loc Qty

Loc Code

FP001

30

B164860 *

127852

30

x1

AN3C5A

Purchased No

260 Each 1,418.000 2 2

AN3C5A

Bolt

**

all 12/08/09

Location

Loc Qty

Loc Code

FG

5

122800

5

FP001

547

M137361

547

x2

OVER002

800

M137710

200

M137963

600

ST350

66

M135442

66

D2965-3

Manufactured No

260 Each 68.0000 1 1

D2965-3

Cap

**

all 12/08/09

Location

Loc Qty

Loc Code

FP001

68

B164859 *

126369

68

x1

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
								OTHER :	

ITEM	QTY	P/N	DESCRIPTION
	X	D4680-041	SKIDTUBE
1	1	D2965	CAP
2	1	D2965-3	CAP
3	1	D4680-043	SKIDTUBE SUB ASSY
4	2	AN3C5A	BOLT
5	2	AN526C1032R10	SCREW
6	2	NAS1149C0332R	WASHER

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 163754

JUL 06 2017

POSITIVE RECALL

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 1.00 ABOVE CENTERLINE PER QSI 005 SECTION 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D4680-041" AND B/N PER QSI 044 METHOD 6.4 ON INNER RADIUS OF SKIDTUBE BEFORE INSTALLING D2965 CAP
- 7) WEIGHT: 19.3 lbs
- 8) SEAL FAYING SURFACES WITH SIKAFLEX -241/-291 OR PROSEAL 890/1422 OR MIL-S-8802 CLASS B-2 SEALANT
- 9) INSTALL FASTENERS WET WITH SIKAFLEX -241/-291 OR PROSEAL 890/1422 OR MIL-S-8802 CLASS B-2 SEALANT

F	GENERAL REFORMAT. SHEET 3: ADD ITEMS 6 & 11 ADD NOTES 11 TO 13 AND ADD DETAIL H. SHEET 5: Ø0.188 WAS 0.750. WEIGHT UPDATE. ADD PROSEAL 1422	AJS	17.03.30
E	GROUND HANDLING CROSSBOLT SPACERS NOW SWAGED. WAS WELDED. REMOVED D3492-055 PLUG ASSEMBLIES	AP	15.11.02
D	MOVED AFT GROUNDING FASTENER HOLE AFT 0.25 DUE TO INTERFERENCE. ADDED NOTE 9 (SHT 1). GROUNDING STRAP WASHERS NOW STAINLESS	AP	15.03.04
C	NAS1149F0332P WAS AN960-10L. AN526C1032R10 WAS AN526C1032-10. FWD GROUNDING STRAP FASTENER MOVED AFT (C5-3). Ø0.750 WAS Ø0.758 (B4-3).	AP	14.07.29
B	FWD CAP WAS D2965 NOW D2965-3. VARIOUS DIMENSIONAL CHANGES. D3492-055 PLUG ASSY WAS D3492-051. SWAGING DIMENSION NOW 0.650 WAS 0.661 (D6-2). ADDED DETAIL H (C2-3). MATERIAL D2962-150 WAS D2962-131 (A7-3). GROUND HANDLING THRU HOLES NOW WELDED. ADDED SECTION G-G (D3-2)	AP	13.09.10
A	NEW ISSUE	AP	13.02.13
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AJS	EUGENE, OR	
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 1 OF 5
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


AN526C1032R10
SCREW
2 PL
9

D2965-3
CAP
8

DETAIL A
SCALE 4X

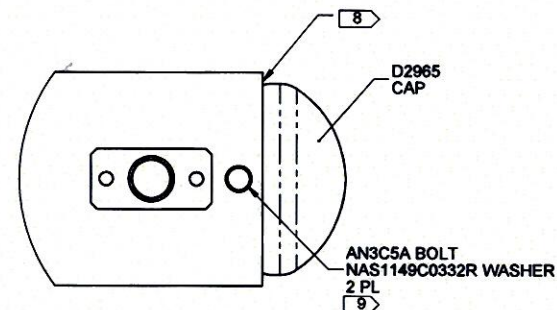



DETAIL B
SCALE 4X

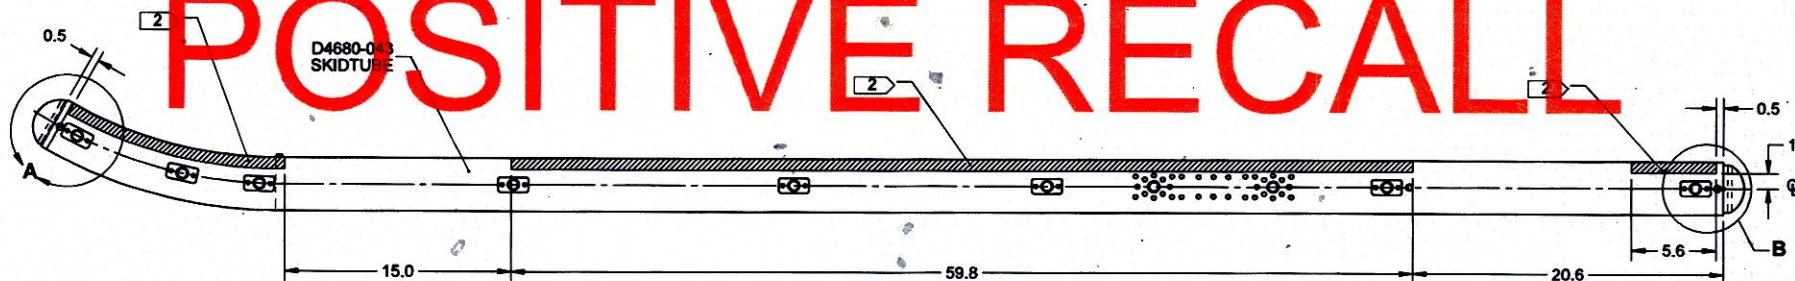

POSITIVE RECALL

DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AJS	EUGENE, OR	
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 2 OF 5
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

ITEM	QTY	P/N	DESCRIPTION
	X	D4680-043	SKIDTUBE SUB ASSY
1	1	D4680-1	SKIDTUBE
2	1	D4681-041	WEB ASSY
3	8	D4686-1	SPACER
4	16	D4753-1	DOUBLER
5	2	D5304-1	CROSSBOLT SPACER
6	2	D5520-1	DOUBLER
7	3	AN3C4A	BOLT
8	32	MS20601AD4W3	RIVET, BLIND, CSK
9	3	NAS1149C0332R	WASHER
10	3	AELS-1032-130	INSERT
11	68	CR3212-5-05	CSK RIVET, CHERRY MAX

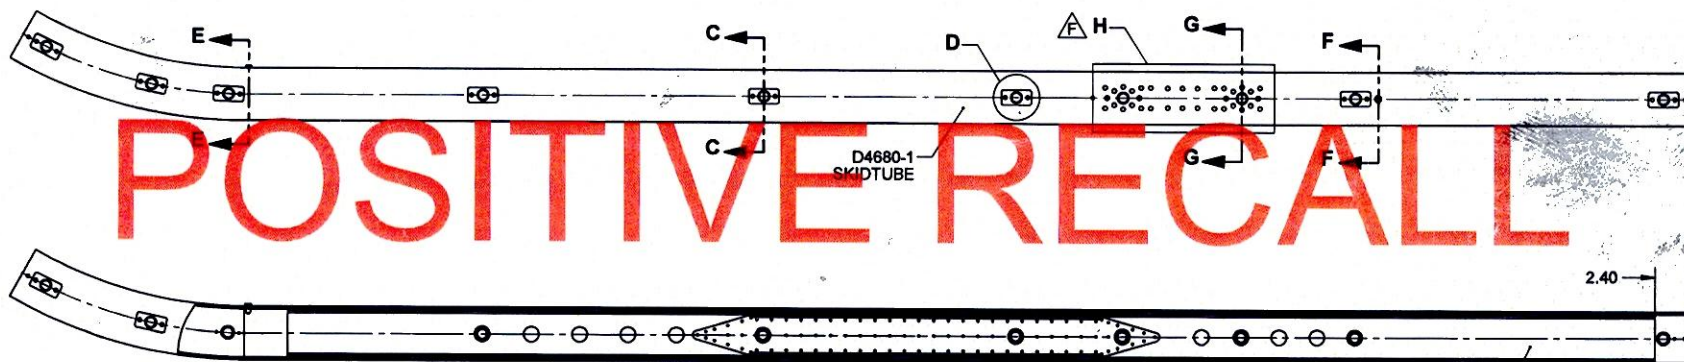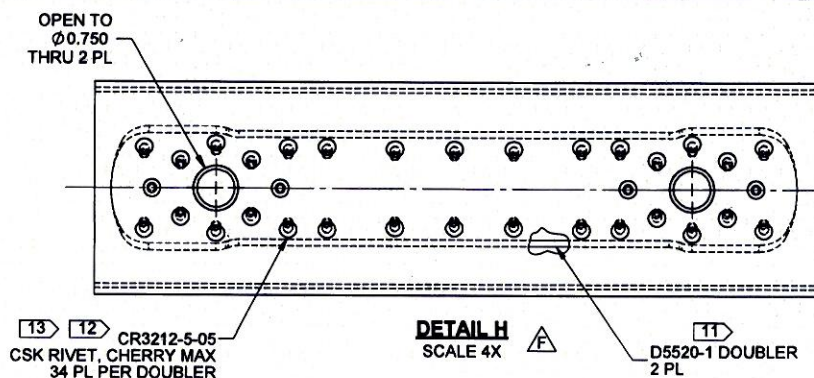


D4680-043 SKIDTUBE SUB ASSY

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: APPLY CHEMICAL CONVERSION COATING PER DART QSI 005 4.1 PRIOR TO INSTALLING D4681-041 WEB. POWDER COAT WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 18.6 lbs
- 8) SEAL ALL MATING SURFACES USING PROSEAL 890/1422 OR MIL-S-8802 CLASS B2 SEALANT
- 9) INSERT D4681-041 WEB INTO D4680-1 SKIDTUBE IN LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX -241/-291 ADHESIVE PER DART QSI 015
- 10) INSTALL D4686-1 SPACER AFTER INSTALLING D4753-1 DOUBLERS
- 11) LOCATE THE D5520-1 DOUBLER USING THE $\varnothing 0.188$ PILOT HOLES ON THE SKIDTUBE AND DOUBLER
- 12) LOCATE QTY (34) HOLES ONTO THE SKIDTUBE PER D5520-1 DOUBLER AND DRILL $\varnothing 0.161$ THRU SKIDTUBE AND DOUBLER USING DT10309
- 13) COUNTERSINK THE SKIDTUBE $\varnothing 0.286 \times 100^\circ$ (34 PL) AND INSTALL EACH D5520-1 DOUBLER USING QTY (34) CR3212-5-05 CSK RIVETS

DESIGN	AP	DART AEROSPACE USA, INC.	
		EUGENE, OR	
DRAWN	AJS	DRAWING NO.	REV. F
CHECKED	ML	D4680	SHEET 3 OF 5
MFG. APPR.	DP	TITLE	SCALE
APPROVED	WM	SKIDTUBE	NTS
DE APPR.	DS	DATE 17.03.30	
		COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIES OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

D4686-1
SPACER

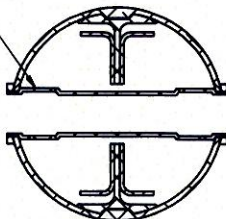


SECTION C-C
SCALE 4X
8 PL

INSTALL D4686-1 SPACER AS FOLLOWS (8 PL)
AFTER INSTALLING D4753-1 DOUBLERS PER DETAIL D

1. INSERT D4686-1 SPACER
2. SWAGE TO $\phi 0.650 \pm 0.010/-0.000 \times 1.0$
3. DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

D5304-1
CROSSBOLT SPACER

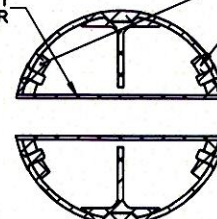


SECTION G-G
SCALE 4X
2 PL

D5520-1 DOUBLER
REF

INSTALL D5304-1 SPACER AS FOLLOWS (2 PL)


1. INSERT D5304-1 SPACER
2. SWAGE TO $\phi 0.565 \pm 0.005/-0.000 \times 1.0$
3. DEEP PER QSI 002
3. OPEN THRU HOLE TO $\phi 0.625$

8
D4753-1
DOUBLER

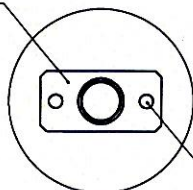


DETAIL D
16 PL (BOTH SIDES)
SCALE 4X

MS20601AD4W3
RIVET, BLIND, CSK
2 PL

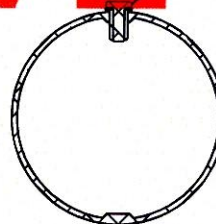

SECTION E-E
SCALE 4X

AN304A BOLT
NAS1149C0332R WASHER
AELS-1032-130 INSERT

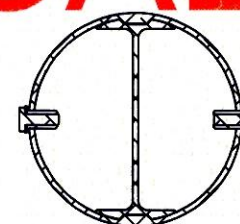


SECTION F-F
SCALE 4X

AN304A BOLT
NAS1149C0332R WASHER
AELS-1032-130 INSERT
2 PL

POSITIVE RECALL

DESIGN	AP	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	AJS		
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 4 OF 5
APPROVED	VM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

ITEM	QTY -041	P/N	DESCRIPTION
	X	D4680-041	SKIDTUBE
1	1	D2965	CAP
2	1	D2965-3	CAP
3	1	D4680-043	SKIDTUBE SUB ASSY
4	2	AN3C5A	BOLT
5	2	AN526C1032R10	SCREW
6	2	NAS1149C0332R	WASHER

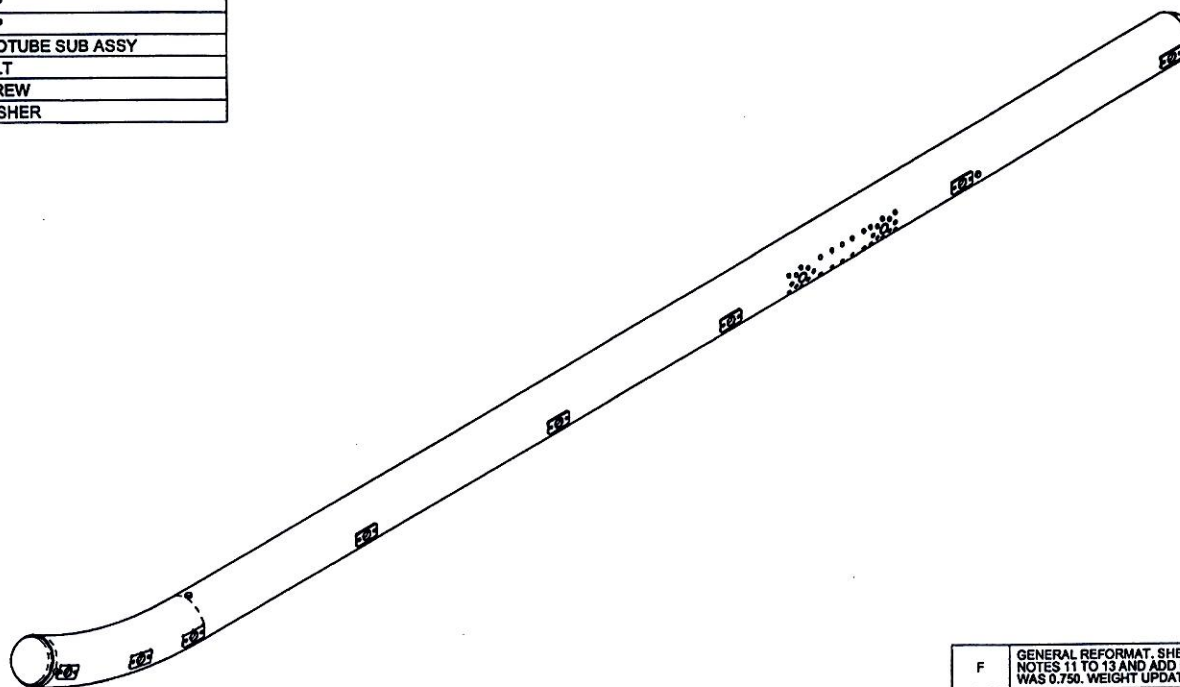


NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 1.00 ABOVE CENTERLINE PER QSI 005 SECTION 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D4680-041" AND B/N PER QSI 044 METHOD 6.4 ON INNER RADIUS OF SKIDTUBE BEFORE INSTALLING D2965 CAP
- 7) WEIGHT: 19.3 lbs
- 8) SEAL FAYING SURFACES WITH SIKAFLEX -241/-291 OR PROSEAL 890/1422 OR MIL-S-8802 CLASS B-2 SEALANT
- 9) INSTALL FASTENERS WET WITH SIKAFLEX -241/-291 OR PROSEAL 890/1422 OR MIL-S-8802 CLASS B-2 SEALANT

RELEASED
2017-08-11
ECN 17-547

F	GENERAL REFORMAT. SHEET 3: ADD ITEMS 8 & 11 ADD NOTES 11 TO 13 AND ADD DETAIL H. SHEET 5: Ø0.188 WAS 0.750. WEIGHT UPDATE. ADD PROSEAL 1422	AJS	17.03.30
E	GROUND HANDLING CROSSBOLT SPACERS NOW SWAGED, WAS WELDED. REMOVED D3492-055 PLUG ASSEMBLIES	AP	15.11.02
D	MOVED AFT GROUNDING FASTENER HOLE AFT 0.25 DUE TO INTERFERENCE, ADDED NOTE 9 (SHT 1), GROUNDING STRAP WASHERS NOW STAINLESS	AP	15.03.04
C	NAS1149F0332P WAS AN980-10L, AN526C1032R10 WAS AN526C1032-10, FWD GROUNDING STRAP FASTENER MOVED AFT (C5-3), Ø0.750 WAS Ø0.758 (B4-3).	AP	14.07.29
B	FWD CAP WAS D2965. NOW D2965-3. VARIOUS DIMENSIONAL CHANGES. D3492-055 PLUG ASSY WAS D3492-051. SWAGING DIMENSION NOW 0.650 WAS 0.661 (D6-2). ADDED DETAIL H (C2-3). MATERIAL D2962-150 WAS D2962-131 (A7-3). GROUND HANDLING THRU HOLES NOW WELDED, ADDED SECTION G-G (D3-2)	AP	13.09.10
A	NEW ISSUE	AP	13.02.13
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	AJS		
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 1 OF 5
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

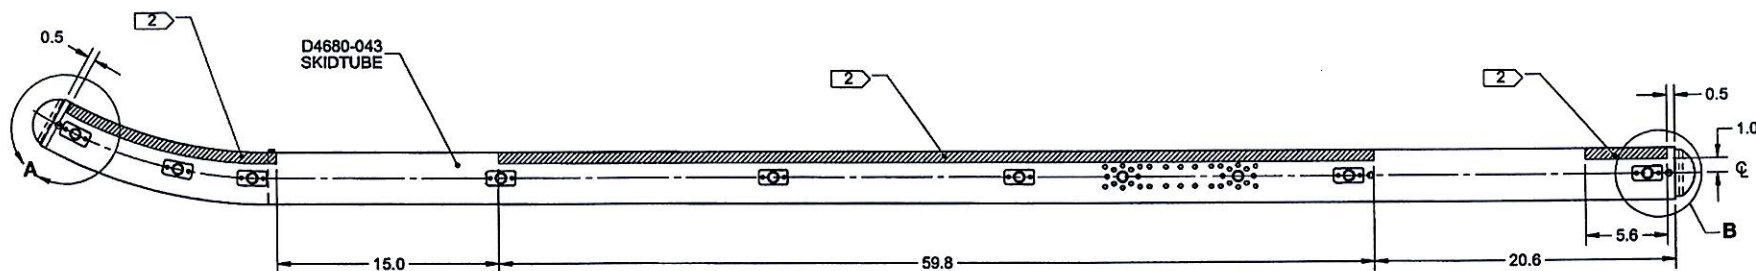



DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AJS	ENGINEERING DEPT.	
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 2 OF 5
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IF IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

RELEASES
2017-08-11



APPROVED

ITEM	QTY	P/N	DESCRIPTION
	X	D4680-043	SKIDTUBE SUB ASSY
1	1	D4680-1	SKIDTUBE
2	1	D4681-041	WEB ASSY
3	8	D4686-1	SPACER
4	16	D4753-1	DOUBLER
5	2	D5304-1	CROSSBOLT SPACER
6	2	D5520-1	DOUBLER
7	3	AN3C4A	BOLT
8	32	MS20601AD4W3	RIVET, BLIND, CSK
9	3	NAS1149C0332R	WASHER
10	3	AELS-1032-130	INSERT
11	68	CR3212-5-05	CSK RIVET, CHERRY MAX

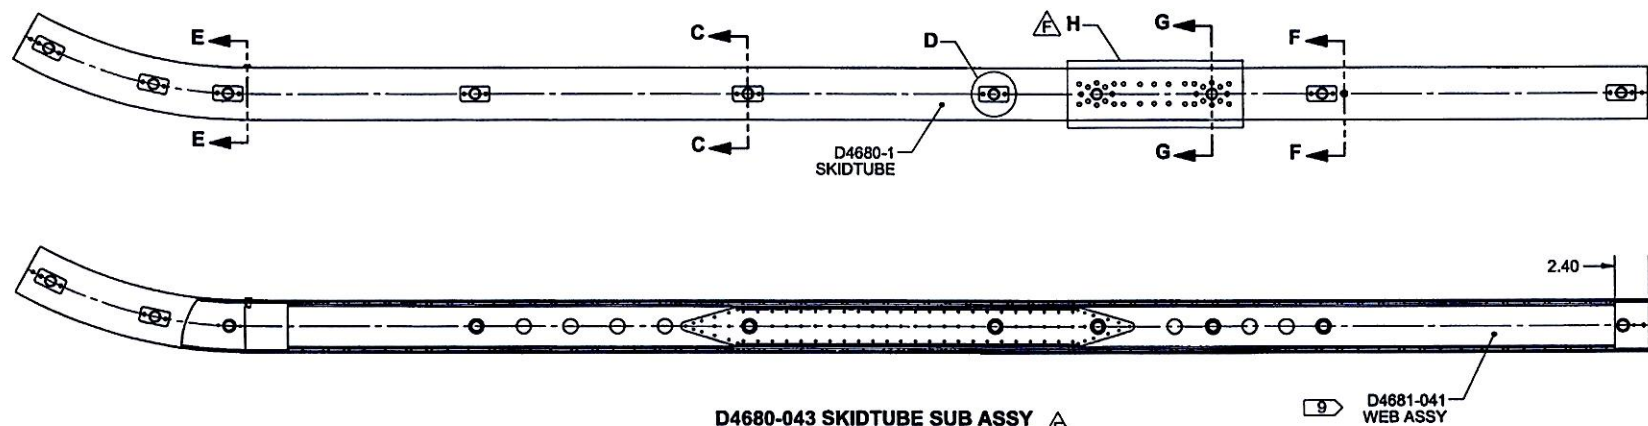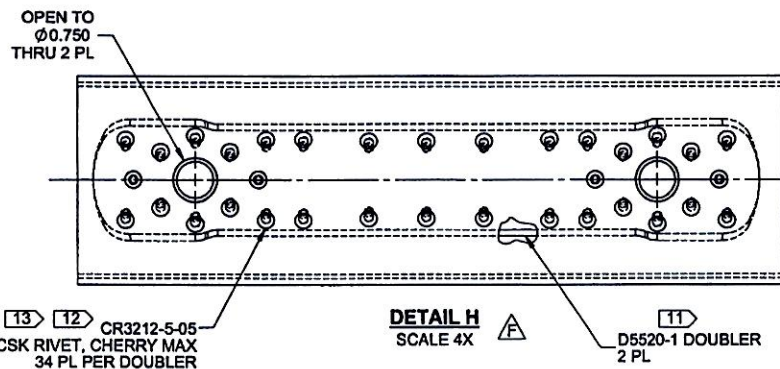


NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: APPLY CHEMICAL CONVERSION COATING PER DART QSI 005 4.1 PRIOR TO INSTALLING D4681-041 WEB. POWDER COAT WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 18.6 lbs
- 8) SEAL ALL MATING SURFACES USING PROSEAL 890/1422 OR MIL-S-8802 CLASS B2 SEALANT
- 9) INSERT D4681-041 WEB INTO D4680-1 SKIDTUBE IN LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX -241/-291 ADHESIVE PER DART QSI 015
- 10) INSTALL D4686-1 SPACER AFTER INSTALLING D4753-1 DOUBLERS
- 11) LOCATE THE D5520-1 DOUBLER USING THE Ø0.188 PILOT HOLES ON THE SKIDTUBE AND DOUBLER
- 12) LOCATE QTY (34) HOLES ONTO THE SKIDTUBE PER D5520-1 DOUBLER AND DRILL Ø0.161 THRU SKIDTUBE AND DOUBLER USING DT10309
- 13) COUNTERSINK THE SKIDTUBE Ø0.286 X 100° (34 PL) AND INSTALL EACH D5520-1 DOUBLER USING QTY (34) CR3212-5-05 CSK RIVETS

RELEASED
2017-08-11

APPROVED


DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AJS	EUGENE, OR	
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 3 OF 5
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

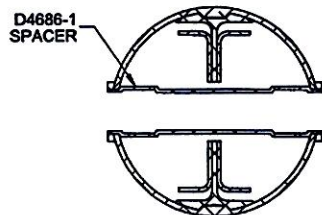

SECTION C-C
SCALE 4X
8 PL

INSTALL D4686-1 SPACER AS FOLLOWS (8 PL)
AFTER INSTALLING D4753-1 DOUBLERS PER DETAIL D


1. INSERT D4686-1 SPACER
2. SWAGE TO $\phi 0.650 +0.010/-0.000 \times 1.0$
DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

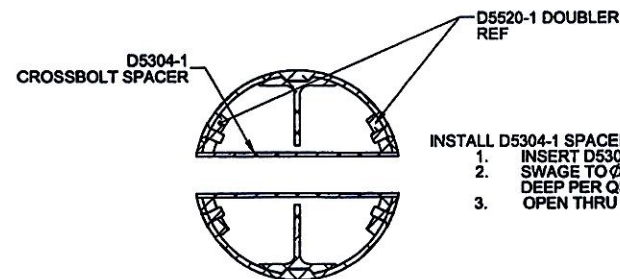


SECTION G-G
SCALE 4X
2 PL

INSTALL D5304-1 SPACER AS FOLLOWS (2 PL)


1. INSERT D5304-1 SPACER
2. SWAGE TO $\phi 0.565 +0.005/-0.000 \times 1.0$
DEEP PER QSI 002
3. OPEN THRU HOLE TO $\phi 0.625$

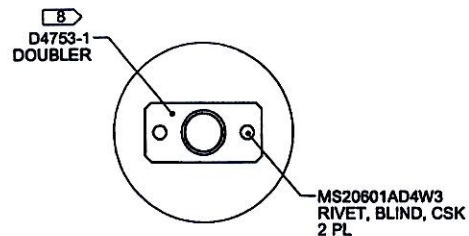

DETAIL D
16 PL (BOTH SIDES)
SCALE 4X

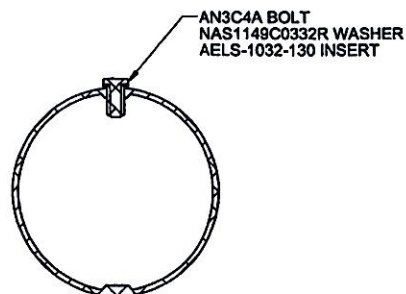

SECTION E-E
SCALE 4X

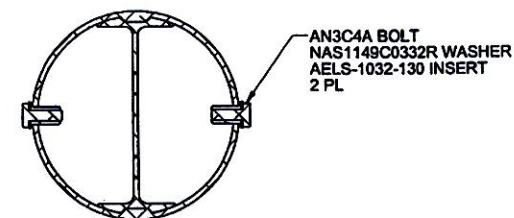

SECTION F-F
SCALE 4X

RELEASED
2017-08-11

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AJS	EUGENE, OR	
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 4 OF 5
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

